



WISCO INDUSTRIES, INC.

PHONE : 608.835.3106 • TOLL FREE : 800.999.4726 • FAX: 608.835.7399 • www.wiscoind.com

**MODEL 620, 621, JJ501, & JJ502W
BLOWER MOTOR REPLACEMENT
0022687SK**


DESCRIPTION

This document illustrates how to replace a Motor Service Kit for models 620,621, JJ501, and JJ502W.



TOOLS NEEDED

- #2 Phillips Screw Driver
- 10mm Socket Wrench or Driver
- Pliers

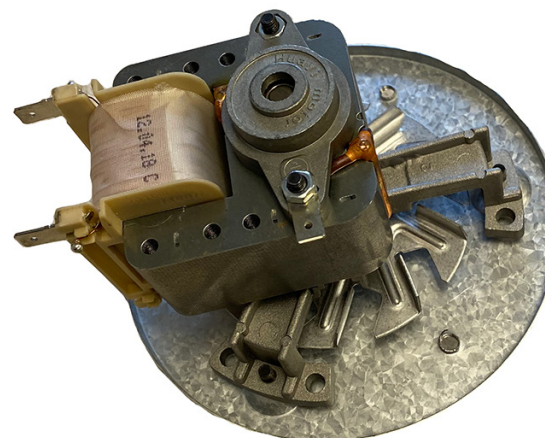

PARTS INCLUDED

- (1) 0022687 - Blower Motor




UNPLUG UNIT FROM OUTLET AND ALLOW TO COOL


- 1** Remove (8) Screws from the back of the unit; remove the back.



- 2** Open the oven door. Once opened, loosen or remove support screws. Once loose, remove support racks

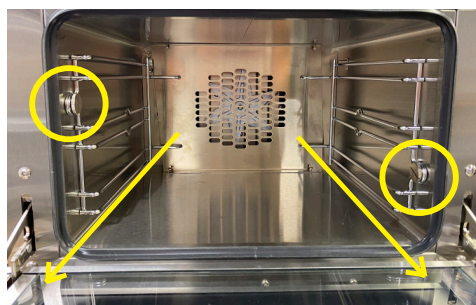


- 3** Remove (4) screws to the panel covering the fan; Remove the panel.

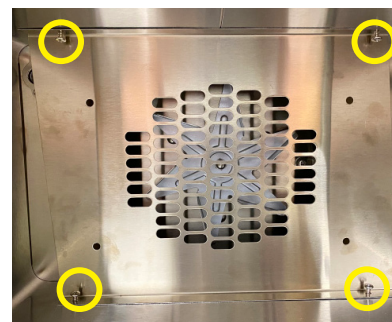


- 4** Using the 10mm socket, remove the nut that is attached to the fan ; remove the fan.


Note: Turn counter-clockwise to tighten and clockwise to loosen

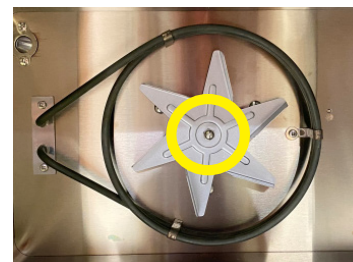

- 5** Remove (3) Screws that hold the blower motor in place

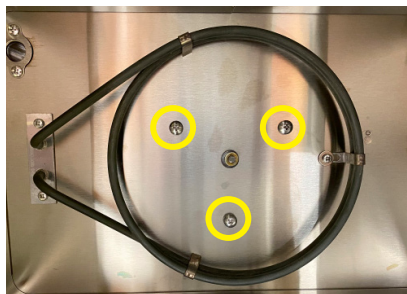

- 6** Remove the motor from the back of the oven and separate the insulation discs from the motor.

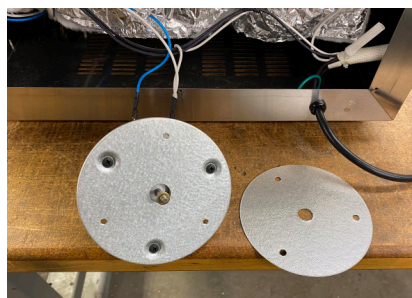

- 7** Remove wires connected to the motor. Using the new motor, complete all steps in reverse order & you have successfully replaced your units blower motor. Your unit is now ready for operation.

